

**Regulatory Compliance
245 Albany Avenue
Thornwood, New York 10594
(914) 439-6513**

**10 NYCRR Subpart 67-4
Testing and Water Management Plan
For
Lead In Drinking Water**

For

**Tuckahoe UFSD
65 Siwanoy Blvd
Eastchester, NY 10709**

at

**High School
Middle School
William E. Cottle School**

Project Number: TUCK.1031.23.IH

Dates of Survey:
April 12, 2023
April 13, 2023

Field Work performed by:
Nicholas Coon, BS

Report Written by:
Ernest Coon, MS, RPIH, HEM

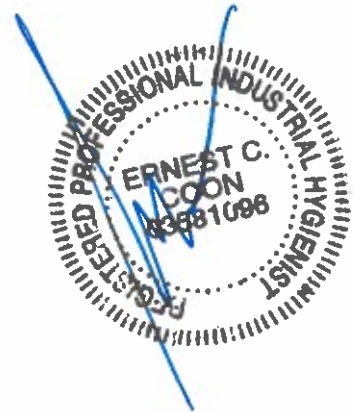


TABLE OF CONTENTS

1. SCOPE OF WORK	3
2. INTRODUCTION	3
3. RECOMMENDED/REQUIRED SAMPLING LOCATIONS	3
4. SAMPLING METHODOLOGY	5
5. SAMPLING LOCATIONS, OBSERVATIONS AND DISCUSSION	6
6. RESPONSE AND CORRECTIVE ACTIONS	7
7. POST-REMEDIATION TESTING	8
8. PUBLIC NOTIFICATION REQUIREMENTS	8
9. ELECTRONIC REPORTING IN HCS/HERDS	9
10. RECORDKEEPING REQUIREMENTS	9
11. BEST MANAGEMENT PRACTICES TO REDUCE LEAD IN DRINKING WATER	9
12. LEAD IN DRINKING WATER SURVEY FACT SHEET	10

Appendix

Appendix A
Appendix B

Tabulated Results
Laboratory Data Sheets

1.0 SCOPE OF WORK

Tuckahoe UFSD retained Regulatory Compliance to test water fixtures in select areas identified by the district for lead content. The overall objective is to determine the lead content in drinking water in the district's buildings.

2.0 INTRODUCTION

Lead is a toxic metal that can be harmful when ingested (or inhaled), and young children are particularly sensitive to the effects of lead. Lead can get into drinking water by being present in the source water, or by interaction of the water with plumbing materials containing lead (through corrosion). Common sources of lead in drinking water include: solder, fluxes, pipes and pipefittings, fixtures, and sediments. Thus, it is possible that different water outlets in a given building could have dissimilar concentrations of lead. Lead in drinking water is regulated under the Safe Drinking Water Act (1974) as amended. The Lead Contamination Control Act (LCCA) amended the Safe Drinking Water Act and is aimed at identifying and reducing lead in drinking water in schools (and day care facilities). In April 1994, EPA prepared two guidance documents to assist municipalities in meeting the requirements of the LCCA. On September 6, 2016, the Department of Health DOH issued emergency regulations for the implementation of the new law, *Lead Testing in School Drinking Water*, the regulations became Subpart 67-4 of Title 10 (Health) of the Official Compilation of Codes, Rule and Regulations of the State of New York. A revised 67-4 went into effect on December 22, 2022.

The following information provided in sections 3-11 are taken from 10 NYCRR Subpart 67-4 and the NYSDOH slide presentation "Lead Testing in School Drinking Water - Program Review and Updates Environmental Health Conference," from October 25, 2022.

3.0 RECOMMENDED/REQUIRED SAMPLING LOCATIONS

Outlets that should be sampled may be located anywhere on school property including external outlets (hose bibs) if the outlet may be used for drinking or cooking (including food preparation).

Samples must be collected at all outlets used or potentially used for drinking or cooking, including but not limited to:

- bubblers/drinking fountains
- classroom sinks
- classroom combination sinks and drinking fountains
- kitchen sinks
- kitchen kettle filler outlets
- bathroom sinks
- family and consumer sciences room sinks
- teachers' lounge sinks
- nurse's office sinks
- athletic field outlets and any other sink known to be or potentially used for consumption (e.g., coffeemaker or cups are nearby)

Applicable VS. Non-Applicable Outlets

Superintendents or their designees have the responsibility to identify which outlets on a school property meet the regulation requirements for sampling (“applicable outlets”).

If a Superintendent or their designee determines that they have outlets that fall outside of the scope of the regulation (outlets not used or potentially used for drinking or cooking), the school must have a remedial action plan that includes details on how those outlets will not be accessed and/or utilized for drinking or cooking purposes (“non- applicable outlets”).

- Food washing sinks: Food washing faucets must be sampled as they are used for cooking (including food preparation) and potentially for drinking.
- Ice machines: The ice made in an ice machine should be sampled for lead.
- Combination bottle fill station and drinking fountain: A sample should be collected from both outlets. The Department recommends sampling the outlet that is most frequently used first.
- Hand washing outlets: In general, all hand washing outlets in a bathroom should be sampled as bathroom outlets may be used to obtain water for drinking and/or food preparation.
- Foot level operated multi-outlet gang sink: In general, samples should be collected from each outlet of a gang sink, however, if the gang sink design does not allow sample collection from each outlet, the schools should contact the local health department or the Department to discuss.
- Traditional outlet with hot and cold-water handle: Samples must be collected from each outlet but only the cold water should be turned on for sampling

Non-Applicable Outlets

In general, any outlet in a room or office within a school that is not used by students (pre-kindergarten through grade 12) and does not provide water for drinking or cooking does not require sampling.

- Dishwashing sinks: If an outlet is designated for dish washing only and involves no opportunity for drinking or cooking (including food preparation), the outlet does not require sampling
- Point of entry: Samples from the point of entry are not required under Subpart 67-4. Point of entry is the location where water enters the building from the distribution system of a public water system.
- Science/Art room outlets: Typically, classrooms in these settings prohibit eating and/or drinking. The school Superintendent has the authority to determine whether these outlets may be used for drinking or cooking and whether they require sampling.

- Tempered outlets: The Department and the US EPA recommend that hot or tempered water not be used for drinking or cooking as warm or hot water increase the leaching of lead into the water.
- Bus garage: Outlets in bus garage buildings do not require sampling unless the building is occupied by students (e.g., BOCES classes).
- Custodial closet outlets: If the outlet is only used for custodial purposes and not for drinking, then the outlet does not need to be sampled.
- Any outlet excluded from sampling should be documented in the Remedial Action Plan (and consider additional controls such locks, signs, and education).

4.0 SAMPLING METHODOLOGY

Samples were collected in accordance with the *Lead Testing in School Drinking Water* – 10 NYCRR Subpart 67-4.3. A first-draw sample was collected in a wide mouth 250 mL bottle and collected from a cold water outlet before the water is used. The water was motionless in the pipes for a minimum of 8 hours, but not more than 18 hours prior to collection.

Sampling Collection Guidance:

- Pre-stagnation flushing: The Department does not allow for pre-stagnation flushing prior to sampling unless a school is directed to do so by the Department or local health department.
- Aerators: Aerators should not be removed prior to sampling

5.0 SAMPLING LOCATIONS, OBSERVATIONS AND DISCUSSION

Sampling Dates: April 12, 2023/ April 13, 2023

The following water fixtures were tested: water fountains (bubblers/bottle fillers) and sinks from the Cottle Elementary School.

A total of one hundred ninety-nine (199) samples (including blanks) were collected and analyzed for lead contaminants. All of the samples collected were within NYSDOH action level and compliant, with the exception of the water fixtures noted below. The sample results for all water fixtures tested are located in Appendix A.

Building	Location	Fixture	Results (mg/L)	Action Limit (mg/L)	Compliant (Y/N)	Remediation
Cottle School	Kitchen	Sink #3	0.006	0.005	N	Required
Cottle School	Library Back Room	Sink	0.019	0.005	N	Required
Cottle School	Room 24	Bubbler	0.031	0.005	N	Required
Cottle School	Room 26	Sink	0.307	0.005	N	Required
Cottle School	Room 27	Sink	0.008	0.005	N	Required
Cottle School	Room 28	Sink	0.024	0.005	N	Required
Cottle School	Room 29	Sink	0.252	0.005	N	Required
Cottle School	Room 30	Bubbler	0.013	0.005	N	Required
Cottle School	Room 33 Office	Sink	0.011	0.005	N	Required
Cottle School	Room 33	Sink	0.008	0.005	N	Required
Cottle School	Room 35	Sink	0.075	0.005	N	Required
Cottle School	Room 35	Bubbler	0.006	0.005	N	Required
Cottle School	Room 37	Sink #2	0.008	0.005	N	Required
Cottle School	Room 37	Sink #5	0.008	0.005	N	Required
Cottle School	Locker Room #2	Sink	0.055	0.005	N	Required

Cottle School	Room 1 st Floor New Wing Girl's Bathroom	Sink #1	0.007	0.005	N	Required
Cottle School	Room 39	Sink	0.006	0.005	N	Required
Cottle School	Room 41	Bubbler	0.018	0.005	N	Required
Cottle School	Room 40	Bubbler	0.008	0.005	N	Required
Cottle School	Room 43	Sink	0.010	0.005	N	Required
Cottle School	Room 41	Sink	0.033	0.005	N	Required
Cottle School	Room 41	Bubbler	0.006	0.005	N	Required
Cottle School	Room 45	Bubbler	0.026	0.005	N	Required
Cottle School	STEM Classroom	Sink	0.008	0.005	N	Required
Cottle School	Neutral Gender Bathroom Near Room 20	Sink	0.008	0.005	N	Required
Cottle School	Room 17	Bubbler	0.014	0.005	N	Required
Cottle School	Room Main Office Bathroom	Sink	0.967	0.005	N	Required
Cottle School	Room 16	Sink	0.018	0.005	N	Required
Cottle School	Room 16	Bubbler	0.006	0.005	N	Required
Cottle School	Room 15	Sink	0.142	0.005	N	Required
Cottle School	Room 14	Sink	0.942	0.005	N	Required
Cottle School	Room 14	Bubbler	0.088	0.005	N	Required
Cottle School	Room 13	Sink	0.040	0.005	N	Required
Cottle School	Room 12	Sink	0.010	0.005	N	Required
Cottle School	Faculty Bathroom Near Room 11	Sink	0.009	0.005	N	Required

Cottle School	Room 6	Sink	0.025	0.005	N	Required
Cottle School	Bathroom Near Head Custodian's Room	Sink	0.009	0.005	N	Required
Cottle School	Room 3	Sink	0.028	0.005	N	Required
Cottle School	Room 1	Bubbler	0.024	0.005	N	Required
High/Middle School	Kitchen	Sink #1	0.011	0.005	N	Required
High/Middle School	Kitchen	Sink #3	0.059	0.005	N	Required
High/Middle School	Girl's Locker Room	Sink #1	0.007	0.005	N	Required
High/Middle School	Girl's Locker Room Office	Sink	0.007	0.005	N	Required
High/Middle School	Water Fountain Main Office Hallway	Bubbler	0.017	0.005	N	Required
High/Middle School	Water Fountain Business Office Hallway	Bubbler	0.050	0.005	N	Required
High/Middle School	Bathroom Left of Middle School Entrance	Sink	0.140	0.005	N	Required
High/Middle School	Boy's Bathroom Near Asst. Superintendent's Office	Sink #1	0.009	0.005	N	Required
High/Middle School	Boy's Bathroom Near Asst. Superintendent's Office	Sink #2	0.231	0.005	N	Required
High/Middle School	Water Fountain Near HS Guidance	Bubbler	0.007	0.005	N	Required
High/Middle School	Girl's Bathroom Near HS Guidance	Sink #2	0.008	0.005	N	Required

High/Middle School	Auditorium Bathroom Stage Left	Sink	0.032	0.005	N	Required
High/Middle School	Auditorium Bathroom Stage Right	Sink	0.033	0.005	N	Required
High/Middle School	Water Fountain Hallway Near Band Room	Bubbler	0.086	0.005	N	Required
High/Middle School	Band Room Office	Sink	0.078	0.005	N	Required
High/Middle School	Room 152	Sink #1	0.023	0.005	N	Required
High/Middle School	Room 152	Sink #2	0.011	0.005	N	Required
High/Middle School	Room 152	Sink #5	0.015	0.005	N	Required
High/Middle School	Tall Water Fountain Hallway Near Gym	Bubbler	0.076	0.005	N	Required
High/Middle School	Lower Water Fountain Hallway Near Gym	Bubbler	0.074	0.005	N	Required
High/Middle School	Men's Bathroom Near Room 268	Sink #1	0.012	0.005	N	Required
High/Middle School	Men's Bathroom Near Room 268	Sink #2	0.008	0.005	N	Required
High/Middle School	Men's Bathroom Near Room 268	Sink #3	0.011	0.005	N	Required
High/Middle School	Women's Bathroom Near Room 268	Sink #1	0.007	0.005	N	Required
High/Middle School	Women's Bathroom Near Room 268	Sink #2	0.008	0.005	N	Required
High/Middle School	AV Room	Sink	0.023	0.005	N	Required
High/Middle School	Room 352	Island Sink #1	0.015	0.005	N	Required

High/Middle School	Room 352	Sink #2	0.018	0.005	N	Required
High/Middle School	Room 352	Sink #4	0.014	0.005	N	Required
High/Middle School	Room 352	Sink #5	0.008	0.005	N	Required
High/Middle School	Room 352	Sink #6	0.008	0.005	N	Required
High/Middle School	Room 352	Sink #7	0.009	0.005	N	Required
High/Middle School	Room 351	Sink #3	0.010	0.005	N	Required
High/Middle School	Room 351	Sink #6	0.035	0.005	N	Required
High/Middle School	Boys Bathroom Near Room 205	Sink #1	0.008	0.005	N	Required
High/Middle School	Hallway Water Fountain Near Room 206	Bubbler	0.036	0.005	N	Required
High/Middle School	Hallway Water Fountain Near Room 210	Bubbler	0.016	0.005	N	Required
High/Middle School	Art Room	Sink #1 (Next to Kiln)	1.048	0.005	N	Required
High/Middle School	Art Room	Sink #2	0.012	0.005	N	Required
High/Middle School	Room 250	Island Sink #1	0.021	0.005	N	Required
High/Middle School	Room 250	Island Sink #5	0.027	0.005	N	Required
High/Middle School	Room 251 (Chemical Prep Room)	Sink	0.027	0.005	N	Required
High/Middle School	Room 253	Sink #2	0.021	0.005	N	Required
High/Middle School	Room 253	Sink #3	0.011	0.005	N	Required
High/Middle School	Room 253	Sink #5	0.007	0.005	N	Required
High/Middle School	Outside Near Field	Spigot #1	0.058	0.005	N	Required

In accordance with *Lead Testing in School Drinking Water – 10 NYCRR Subpart 67-4*, outlets that exceed the NYS Action Level are obligated to take corrective action. The required actions, notifications, reporting and recordkeeping requirements are listed in the appropriate sections of this report.

For all outlets not used or potentially used for drinking or cooking, the school must have a remedial action plan that includes details on how those outlets will not be accessed and/or utilized for drinking or cooking purposes (“non- applicable outlets”).

If any inoperable water fixtures during the time of the survey are made operable in the future or new water fixtures are installed, they must be tested prior to use and incorporated into the Water Management Plan.

6.0 RESPONSE AND CORRECTIVE ACTIONS

Steps following an Action Level Exceedance Immediate Response

- Prohibit the use of the outlet immediately (take outlet out of service or turn off) until:
(1) A lead remedial action plan is implemented to mitigate the lead level at the outlet, and
(2) Post-remediation test results indicate that the lead levels are at or below the action level;
- Provide building occupants with an adequate supply of water for drinking and cooking until remediation is performed;
- Report the test results to the local health department as soon as practicable, but no more than 1 business day after the school received the laboratory report;
- Notify all staff and all persons in parental relation to students of the test results, in writing, as soon as practicable but no more than 10 business days after the School received the laboratory report.

Corrective Actions / Remediation Options

- Permanent removal of an outlet
- Outlet replacement with “lead-free” plumbing materials
- Pipe replacement with “lead-free” plumbing materials
- Remove other sources of lead (lead pipe, lead solder joints, and brass plumbing components with “lead-free” materials)
- Flushing (systematic flushing program)
- Point of Use (POU) Filters
- Supervision
- Engineering controls
- Education
- Signage

Signage Options:



7.0 Post-Remediation Testing

- Follow-up samples collected after an outlet has been remediated must also be “first-draw” samples. Schools may choose to perform additional sampling (i.e., 30-second flush, etc.) to determine the contribution of lead from plumbing to guide remediation decisions.
- Only those outlets that exceed the action level need to be resampled (following remediation).
- All remediated outlets will likely require flushing prior to being placed back into service.
- Post-remediation tests results need to be reported:
 - in the Department’s HERDS application on HCS, and
 - on the school’s website within the same reporting timeframes/requirements as specified for the initial sampling (addressed in next section).

8.0 Public Notification Requirements

- Within 1 business day of receipt of laboratory reports:
 - Report any and all exceedances (lead result greater than 5 ppb) to the local health department
- Within 10 business days of receipt of laboratory reports:

- Report all exceedances to all staff, parents, and guardians in writing school. A physical written notification is required.
- Report test results (including post-remediation results) in the Department's electronic reporting system, HERDS accessed through HCS. This information is posted on the Department's website for the public
- Within 6 weeks of receipt of laboratory reports:
 - Post numeric test results of all lead testing and information about remediation actions taken to address outlets where lead exceeded the action level on the school's website. This should remain posted on the school's website for the duration of the compliance period (i.e. 2020-2024)
- Report any lead-free buildings on the school's website
- Within 6 weeks of receipt of laboratory reports:
 - Post numeric test results of all lead testing and information about remediation actions taken to address outlets where lead exceeded the action level on the school's website. Laboratory reports must be included. This should remain posted on the school's website for the duration of the compliance period (i.e. 2023-2025)

9.0 Electronic Reporting in HCS/HERDS

- Within 10 business days of receipt of laboratory reports: Summary data must be reported in the Department's electronic reporting system, HERDS accessed through HCS. Summary data includes:
 - General information (lead-free status, website address)
 - Sampling information
 - Lead analysis results
 - Response and remediation
- Do not submit laboratory reports directly to the Department or local health department unless otherwise directed.

10.0 Recordkeeping Requirements

- Schools must retain all records of:
 - Test results
 - Remedial action plans
 - Determinations that a building is lead-free; and
 - Waiver requests (only applicable to compliance year 2016)
- Per Subpart 67-4, schools must retain records for 10 years following document creation (Note: other agencies may have additional records retention requirements, i.e., NYS Department of Labor)
- Copies of documents must be provided to the Department, the NY State Education Department, or the local health department upon request
- Department recommends that all records be kept in a centrally located and accessible repository for each school building

11.0 Best Management Practices to Reduce Lead in Drinking Water

- Aerator cleaning
- Routine flushing practices (after vacations and long weekends)
- Use only certified lead-free materials when performing plumbing work
- Follow the manufacturer's recommendations for water softener settings to ensure an appropriate level of hardness
- Temperature control
- Educating staff and students of the benefits of running water at a tap briefly prior to using it for drinking or food preparation. Letting the water run for 30- 60 seconds or until the water feels cold can reduce the potential levels of lead in the drinking water

12.0 Lead in Drinking Water Survey Fact Sheet

Name and Address of Building/Structure Owner:

Tuckahoe UFSD
65 Siwanoy Blvd
Eastchester, NY 10709

Name and Address of Buildings/Structures Surveyed:

HS/MS
Tuckahoe UFSD
65 Siwanoy Blvd
Eastchester, NY 10709

William E. Cottle School
2 Siwanoy Blvd
Irvington, NY 10709

Name of the Firm & Person Conducting the Survey:

Regulatory Compliance
Nicholas Coon
PO Box 132
Thornwood, New York 10594

Dates Survey Was Conducted:

April 12, 2023
April 13, 2023

Tabulated Results

High School//Middle School

Sample ID #	Sample Location	Type of Fixture	Date Sampled	Results (mg/L)	Action Level (mg/L)	Compliant (Y/N)	Remediation
1	Kitchen	Sink #1	4.13.23	0.011	0.005	N	Required
2	Kitchen	Sink #2	4.13.23	0.001	0.005	Y	NA
3	Kitchen	Sink #3	4.13.23	0.059	0.005	N	Required
4	Cafeteria Serving Side	Sink	4.13.23	0.001	0.005	Y	NA
5	Water Fountain Outside Kitchen	Bottle Filler	4.13.23	BDL <0.001	0.005	Y	NA
6	Home Careers Room	Sink	4.13.23	0.001	0.005	Y	NA
7	Room 128 Office	Sink #1	4.13.23	BDL <0.001	0.005	Y	NA
8	Room 128 Office	Sink #2	4.13.23	BDL <0.001	0.005	Y	NA
9	Room 128 Bathroom	Sink	4.13.23	0.002	0.005	Y	NA
10	Girl's Locker Room	Sink #1	4.13.23	0.007	0.005	N	Required
11	Girl's Locker Room	Sink #2	4.13.23	BDL <0.001	0.005	Y	NA
12	Girl's Locker Room Office	Sink	4.13.23	0.007	0.005	N	Required
13	Bathroom Across From Room 128	Sink	4.13.23	0.001	0.005	Y	NA
14	Bathroom Across From Boiler Room	Sink	4.13.23	0.002	0.005	Y	NA
15	Boy's Locker Room	Sink #1	4.13.23	0.003	0.005	Y	NA
16	Boy's Locker Room	Sink #2	4.13.23	0.001	0.005	Y	NA
17	Boy's Locker Room	Sink #3	4.13.23	BDL <0.001	0.005	Y	NA
18	Boy's Locker Room Office	Sink	4.13.23	0.001	0.005	Y	NA
19	Custodial Office	Sink	4.13.23	BDL <0.001	0.005	Y	NA
20	Custodial Office	Ice Machine	4.13.23	BDL <0.001	0.005	Y	NA
21	Teacher's Lounge	Sink	4.13.23	BDL <0.001	0.005	Y	NA
22	Teacher's Lounge Bathroom By Entrance	Sink #1	4.13.23	0.001	0.005	Y	NA

23	Teacher's Lounge Bathroom Far Side	Sink	4.13.23	BDL <0.001	0.005	Y	NA
24	Water Fountain Hallway Near Main Office	Bubbler	4.13.23	0.017	0.005	N	Required
25	Nurses Bathroom	Sink	4.13.23	0.002	0.005	Y	NA
26	Main Office Bathroom #1	Sink	4.13.23	0.004	0.005	Y	NA
27	Main Office Bathroom #2	Bubbler	4.13.23	0.002	0.005	Y	NA
28	Water Fountain Hallway Near Business Office	Bubbler	4.13.23	0.05	0.005	N	Required
29	Bathroom Near Superintendent's Office Closer to the stairs	Sink	4.13.23	0.004	0.005	Y	NA
30	Bathroom Left Of Middle School Entrance	Sink	4.13.23	0.14	0.005	N	Required
31	Superintendent's Office	Sink	4.13.23	0.004	0.005	Y	NA
32	Boy's Bathroom Near Assist. Superintendent's Office	Sink #1	4.13.23	0.009	0.005	N	Required
33	Boy's Bathroom Near Assist. Superintendent's Office	Sink #2	4.13.23	0.231	0.005	N	Required
34	Water Fountain Near High School Guidance Office	Bubbler	4.13.23	0.007	0.005	N	Required
35	Girl's Bathroom Near High School Guidance Office	Sink #1	4.13.23	0.005	0.005	Y	NA
36	Girl's Bathroom Near High School Guidance Office	Sink #2	4.13.23	0.008	0.005	N	Required
37	Auditorium Bathroom Stage Left	Sink	4.13.23	0.032	0.005	N	Required
38	Auditorium Bathroom Stage Right	Sink	4.13.23	0.033	0.005	N	Required

39	Water Fountain Hallway Near Band Room	Bubbler	4.13.23	0.086	0.005	N	Required
40	Band Office	Sink	4.13.23	0.078	0.005	N	Required
41	Room 152	Sink #1	4.13.23	0.023	0.005	N	Required
42	Room 152	Sink #2	4.13.23	0.011	0.005	N	Required
43	Room 152	Sink #3	4.13.23	0.002	0.005	Y	NA
44	Room 152	Sink #4	4.13.23	BDL <0.001	0.005	Y	NA
45	Room 152	Sink #5	4.13.23	0.015	0.005	N	Required
46	Room 152	Sink #6	4.13.23	BDL <0.001	0.005	Y	NA
47	Tall Water Fountain Near Gym	Bubbler	4.13.23	0.076	0.005	N	Required
48	Lower Water Fountain Near Gym	Bubbler	4.13.23	0.074	0.005	N	Required
49	Water Fountain Hallway Near Room 268	Bottler Filler	4.13.23	0.001	0.005	Y	NA
50	Men's Bathroom Room 268	Sink #1	4.13.23	0.012	0.005	N	Required
51	Men's Bathroom Room 268	Sink #2	4.13.23	0.008	0.005	N	Required
52	Men's Bathroom Room 268	Sink #3	4.13.23	0.011	0.005	N	Required
53	Women's Bathroom Room 268	Sink #1	4.13.23	0.007	0.005	N	Required
54	Women's Bathroom Room 268	Sink #2	4.13.23	0.008	0.005	N	Required
55	AV Room	Sink	4.13.23	0.023	0.005	N	Required
56	Girl's Bathroom Near Room 208	Sink #1	4.13.23	0.003	0.005	Y	NA
57	Girl's Bathroom Near Room 208	Sink #2	4.13.23	0.004	0.005	Y	NA
58	Girl's Bathroom Near Room 311	Sink #1	4.13.23	0.002	0.005	Y	NA
59	Girl's Bathroom Near Room 311	Sink #2	4.13.23	0.004	0.005	Y	NA
60	Water Fountain Hallway Near Room 308/311	Bubbler	4.13.23	BDL <0.001	0.005	Y	NA

61	Water Fountain Hallway Near Room 314	Bubbler	4.13.23	0.003	0.005	Y	NA
62	Water Fountain Hallway Near Room 302	Bubbler	4.13.23	0.002	0.005	Y	NA
63	Boy's Bathroom Near Room 309	Sink #1	4.13.23	0.004	0.005	Y	NA
64	Boy's Bathroom Near Room 309	Sink #2	4.13.23	0.001	0.005	Y	NA
65	Room 352	Island Sink #1	4.13.23	0.015	0.005	N	Required
66	Room 352	Sink #2	4.13.23	0.018	0.005	N	Required
67	Room 352	Sink #3	4.13.23	0.003	0.005	Y	NA
68	Room 352	Sink #4	4.13.23	0.014	0.005	N	Required
69	Room 352	Sink #5	4.13.23	0.008	0.005	N	Required
70	Room 352	Sink #6	4.13.23	0.008	0.005	N	Required
71	Room 352	Sink #7	4.13.23	0.009	0.005	N	Required
72	Room 351	Sink #1	4.13.23	0.001	0.005	Y	NA
73	Room 351	Sink #2	4.13.23	0.001	0.005	Y	NA
74	Room 351	Sink #3	4.13.23	0.01	0.005	N	Required
75	Room 351	Sink #4	4.13.23	0.005	0.005	Y	NA
76	Room 351	Sink #5	4.13.23	0.004	0.005	Y	NA
77	Room 351	Sink #6	4.13.23	0.035	0.005	N	Required
78	Room 351	Sink #7	4.13.23	0.001	0.005	Y	NA
79	Boy's Room Near Room 205	Sink #1	4.13.23	0.008	0.005	N	Required
80	Water Fountain Hallyway Near Room 206	Bubbler	4.13.23	0.036	0.005	N	Required
81	Water Fountain Hallyway Near Room 210	Bubbler	4.13.23	0.016	0.005	N	Required
82	Water Fountain Hallyway Near Room 202B	Bottle Filler	4.13.23	BDL <0.001	0.005	Y	NA
83	Art Room	Sink #1 Next To	4.13.23	1.048	0.005	N	Required

84	Art Room	Sink #2	4.13.23	0.012	0.005	N	Required
85	Art Room	Sink #3	4.13.23	0.003	0.005	Y	NA
86	Room 259	Island Sink #1	4.13.23	0.021	0.005	N	Required
87	Room 259	Island Sink #2	4.13.23	0.001	0.005	Y	NA
88	Room 259	Island Sink #3	4.13.23	0.002	0.005	Y	NA
89	Room 259	Island Sink #4	4.13.23	0.002	0.005	Y	NA
90	Room 259	Island Sink #5	4.13.23	0.027	0.005	N	Required
91	Room 259	Island Sink #6	4.13.23	BDL <0.001	0.005	Y	NA
92	Room 259	Island Sink #7	4.13.23	0.005	0.005	Y	NA
93	Room 251 Chemical Prep Room	Sink	4.13.23	0.027	0.005	N	Required
94	Room 252	Island Sink #1	4.13.23	0.001	0.005	Y	NA
95	Room 252	Island Sink #2	4.13.23	0.001	0.005	Y	NA
96	Room 252	Island Sink #3	4.13.23	BDL <0.001	0.005	Y	NA
97	Room 252	Island Sink #4	4.13.23	BDL <0.001	0.005	Y	NA
98	Room 252	Island Sink #5	4.13.23	BDL <0.001	0.005	Y	NA
99	Room 252	Island Sink #6	4.13.23	BDL <0.001	0.005	Y	NA
100	Room 252	Island Sink #7	4.13.23	0.005	0.005	Y	NA
101	Room 253	Sink #2	4.13.23	0.021	0.005	N	Required
102	Room 253	Sink #3	4.13.23	0.011	0.005	N	Required
103	Room 253	Sink #4	4.13.23	0.001	0.005	Y	NA
104	Room 253	Sink #5	4.13.23	0.007	0.005	N	Required
105	Room 253	Sink #6	4.13.23	0.002	0.005	Y	NA
106	Room 253	Sink #7	4.13.23	0.005	0.005	Y	NA
107	Room 253	Sink #8	4.13.23	BDL <0.001	0.005	Y	NA
108	Outdoor By Field	Spigot #1	4.13.23	0.058	0.005	N	Required
109	Outdoor By Field	Spigot #2	4.13.23	0.001	0.005	Y	NA
110	Outdoor By Field	Spigot #3	4.13.23	0.001	0.005	Y	NA
111	Blank	NA	4.13.23	BDL <0.001	0.005	Y	NA

NA = Not Applicable
NYS Lead Action Level 0.005 mg/L
*Sinks are counted from Left to Right

Tuckahoe UFSD - Cottle School							
Sample ID #	Sample Location	Type of Fixture	Date Sampled	Results (mg/L)	Action Level (mg/L)	Compliant (Y/N)	Remediation
1	Kitchen	Sink #1	4.12.23	0.001	0.005	Y	NA
2	Kitchen	Sink #2	4.12.23	0.001	0.005	Y	NA
3	Kitchen	Sink #3	4.12.23	0.006	0.005	N	Required
4	Water Fountain Cafeteria	Bottle Filler	4.12.23	BDL <0.001	0.005	Y	NA
5	Library Back Room	Sink	4.12.23	0.019	0.005	N	Required
6	Room 24	Sink	4.12.23	0.004	0.005	Y	NA
7	Room 24	Bubbler	4.12.23	0.031	0.005	N	Required
8	Room 26	Sink	4.12.23	0.307	0.005	N	Required
9	Room 27	Sink	4.12.23	0.008	0.005	N	Required
10	Room 28	Sink	4.12.23	0.024	0.005	N	Required
11	Room 29	Sink	4.12.23	0.252	0.005	N	Required
12	Room 29	Bubbler	4.12.23	0.001	0.005	Y	NA
13	Room 30	Sink	4.12.23	0.005	0.005	Y	NA
14	Room 30	Bubbler	4.12.23	0.013	0.005	N	Required
15	Room 31	Sink	4.12.23	0.003	0.005	Y	NA
16	Room 32	Sink	4.12.23	0.001	0.005	Y	NA
17	Room 32	Bubbler	4.12.23	BDL <0.001	0.005	Y	NA
18	Room 33 Office	Sink	4.12.23	0.011	0.005	N	Required
19	Room 33	Sink	4.12.23	0.008	0.005	N	Required
20	Room 35	Sink	4.12.23	0.075	0.005	N	Required
21	Room 35	Bubbler	4.12.23	0.006	0.005	N	Required
22	Adult Toilet Near Room 36	Sink	4.12.23	0.004	0.005	Y	NA
23	Room 37	Sink #1	4.12.23	0.002	0.005	Y	NA

24	Room 37	Sink #2	4.12.23	0.008	0.005	N	Required
25	Room 37	Sink #3	4.12.23	0.003	0.005	Y	NA
26	Room 37	Sink #4	4.12.23	0.005	0.005	Y	NA
27	Room 37	Sink #5	4.12.23	0.008	0.005	N	Required
28	Locker Room #2	Sink	4.12.23	0.055	0.005	N	Required
29	1st Floor - New Wing-Girl's Room	Sink #1	4.12.23	0.007	0.005	N	Required
30	1st Floor - New Wing-Girl's Room	Sink #2	4.12.23	0.004	0.005	Y	NA
31	Water Fountain Hallway Near Room 38	Bottle Filler	4.12.23	BDL <0.001	0.005	Y	NA
32	Boy's Bathroom Near Room 38	Sink #1	4.12.23	BDL <0.001	0.005	Y	NA
33	Boy's Bathroom Near Room 38	Sink #2	4.12.23	BDL <0.001	0.005	Y	NA
34	Room 38	Sink	4.12.23	0.004	0.005	Y	NA
35	Room 39	Sink	4.12.23	0.006	0.005	N	Required
36	Room 39	Bubbler	4.12.23	0.003	0.005	Y	NA
37	Room 41	Sink	4.12.23	0.001	0.005	Y	NA
38	Room 41	Bubbler	4.12.23	0.018	0.005	N	Required
39	Room 40	Sink	4.12.23	0.003	0.005	Y	NA
40	Room 40	Bubbler	4.12.23	0.008	0.005	N	Required
41	Room 43	Sink	4.12.23	0.01	0.005	N	Required
42	Room 41	Sink	4.12.23	0.033	0.005	N	Required
43	Room 41	Bubbler	4.12.23	0.006	0.005	N	Required
44	Room 45	Sink	4.12.23	0.005	0.005	Y	NA

45	Room 45	Bubbler	4.12.23	0.026	0.005	N	Required
46	Room 44	Sink	4.12.23	0.001	0.005	Y	NA
47	Room 44	Bubbler	4.12.23	0.002	0.005	Y	NA
48	Water Fountain Hallway Near Elevator	Sink	4.12.23	BDL <0.001	0.005	Y	NA
49	2nd Floor-All Gender Bathroom/Staff Bathroom	Sink	4.12.23	BDL <0.001	0.005	Y	NA
50	STEM Classroom	Sink	4.12.23	0.008	0.005	N	Required
51	Room 20	Sink	4.12.23	0.001	0.005	Y	NA
52	All Gender Bathroom Near Room 20	Sink	4.12.23	0.008	0.005	N	Required
53	Boy's Room Near Asst. Principal's Office	Sink #1	4.12.23	0.001	0.005	Y	NA
54	Boy's Room Near Asst. Principal's Office	Sink #2	4.12.23	0.001	0.005	Y	NA
55	Boy's Room Near Asst. Principal's Office	Sink #3	4.12.23	0.001	0.005	Y	NA
56	Girl's Bathroom Near Room 19	Sink #1	4.12.23	0.003	0.005	Y	NA
57	Girl's Bathroom Near Room 19	Sink #2	4.12.23	0.002	0.005	Y	NA

58	Girl's Bathroom Near Room 19	Sink #3	4.12.23	0.001	0.005	Y	NA
59	Girl's Bathroom Near Room 19	Sink #4	4.12.23	0.002	0.005	Y	NA
60	Room 19- Nurses Room	Sink	4.12.23	0.002	0.005	Y	NA
61	Room 17	Sink	4.12.23	0.002	0.005	Y	NA
62	Room 17	Bubbler	4.12.23	0.014	0.005	N	Required
63	Main Office Bathroom	Sink	4.12.23	0.967	0.005	N	Required
64	Room 16	Sink	4.12.23	0.018	0.005	N	Required
65	Room 16	Bubbler	4.12.23	0.006	0.005	N	Required
66	Room 15	Sink	4.12.23	0.142	0.005	N	Required
67	Room 14	Sink	4.12.23	0.942	0.005	N	Required
68	Room 14	Sink	4.12.23	0.088	0.005	N	Required
69	Room 13	Sink	4.12.23	0.04	0.005	N	Required
70	Room 12	Sink	4.12.23	0.01	0.005	N	Required
71	Room 12	Bubbler	4.12.23	0.002	0.005	Y	NA
72	Water Fountain Hallway Near Room 10	Bottle Filler	4.12.23	0.001	0.005	Y	NA
73	Water Fountain Hallway Near Room 10	Bubbler	4.12.23	0.001	0.005	Y	NA
74	All Gender Bathroom Near Room 11	Sink	4.12.23	0.002	0.005	Y	NA
75	Faculty Bathroom Near Room 11	Sink	4.12.23	0.009	0.005	N	Required
76	Room 6	Sink	4.12.23	0.025	0.005	N	Required
77	Room 6	Bubbler	4.12.23	0.001	0.005	Y	NA

78	Room 5	Sink	4.12.23	0.004	0.005	Y	NA
79	Room 5	Bubbler	4.12.23	BDL <0.001	0.005	Y	NA
80	Bathroom Near Head Custodian's Office	Sink	4.12.23	0.009	0.005	N	Required
81	Room 4	Sink	4.12.23	0.002	0.005	Y	NA
82	Room 3	Sink	4.12.23	0.028	0.005	N	Required
83	Room 3	Bubbler	4.12.23	0.001	0.005	Y	NA
84	Room 2A	Sink	4.12.23	0.001	0.005	Y	NA
85	Room 2A	Bubbler	4.12.23	BDL <0.001	0.005	Y	NA
86	Room 1	Sink	4.12.23	BDL <0.001	0.005	Y	NA
87	Room 1	Bubbler	4.12.23	0.024	0.005	N	Required
88	Blank	NA	4.12.23	BDL <0.001	0.005	Y	NA

NYS Lead Action Level 0.005 mg/L
 Sinks are counted from Left to Right
 NA = Not Applicable

Laboratory Data Sheets

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Middle School/High School

Date Collected: 04/13/2023

Collected By: Nicholas Coon

Date Received: 04/13/2023

Date Analyzed: 04/18/2023

Analyzed By: Ernest Sanchez

Signature: 

Analyte: Pb Water

Analytical Method: EPA 200.9

NYS Lab Number: 10851

Client: RegCom

245 Albany Avenue

Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
1 2908243	Kitchen	Sink #1 (Left to Right)	0.011 mg/L
2 2908244	Kitchen	Sink #2	0.001 mg/L
2908245	Kitchen	Sink #3	0.059 mg/L
4 2908246	Serving Side Cafeteria	Sink	0.001 mg/L
5 2908247	Outside Kitchen	Bottle Filler	BDL < 0.001 mg/L
6 2908248	Home Careers Room	Sink	0.001 mg/L
7 2908249	Room 128 Office	Sink #1 (Left to Right)	BDL < 0.001 mg/L
8 2908250	Room 128 Office	Sink #2	BDL < 0.001 mg/L
9 2908251	Room 128 Bathroom	Sink	0.002 mg/L

BDL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LA000107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Middle School/High School

Date Collected: 04/13/2023

Collected By: Nicholas Coon

Date Received: 04/13/2023

Date Analyzed: 04/18/2023

Analyzed By: Ernest Sanchez

Signature: 

Analyte: Pb Water

Analytical Method: EPA 200.9

NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
10 2908252	Girls Locker Room	Sink #1 (Left to Right)	0.007 mg/L
11 2908253	Girls Locker Room	Sink #2	BDL < 0.001 mg/L
12 2908254	Girls Locker Room Office	Sink	0.007 mg/L
13 2908255	Bathroom Across from 128	Sink	0.001 mg/L
14 2908256	Bathroom Across from Boiler Room	Sink	0.002 mg/L
15 2908257	Boys Locker Room	Sink #1 (Left to Right)	0.003 mg/L
16 2908258	Boys Locker Room	Sink #2	0.001 mg/L
17 2908259	Boys Locker Room	Sink #3	BDL < 0.001 mg/L
18 2908260	Boys Locker Room Office	Sink	0.001 mg/L

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Middle School/High School


Date Collected: 04/13/2023

Collected By: Nicholas Coon

Date Received: 04/13/2023

Date Analyzed: 04/18/2023

Analyzed By: Ernest Sanchez

Signature: 

Analyte: Pb Water

Analytical Method: EPA 200.9

NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
19 2908261	Custodial Office	Sink	BDL < 0.001 mg/L
20A/20B 2908262	Custodial Office	Ice Machine	BDL < 0.001 mg/L
 2908263	Teachers Lounge	Sink	BDL < 0.001 mg/L
22 2908264	Teachers Lounge Bathroom by Entrance	Sink	0.001 mg/L
23 2908265	Teachers Lounge Bathroom Far Side	Sink	BDL < 0.001 mg/L
24 2908266	Hallway by Main Office	Bubbler	0.017 mg/L
25 2908267	Nurses Bathroom	Sink	0.002 mg/L
26 2908268	Main Office Bathroom #1 (Left to Right)	Sink	0.004 mg/L
27 2908269	Main Office Bathroom #2	Sink	0.002 mg/L

DL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LA000107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Middle School/High School

Date Collected: 04/13/2023
Collected By: Nicholas Coon
Date Received: 04/13/2023
Date Analyzed: 04/18/2023
Analyzed By: Ernest Sanchez

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Signature: 

Analyte: Pb Water

Analytical Method: EPA 200.9

NYS Lab Number: 10851

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
28 2908270	Hallway by Business Office	Bubbler	0.050 mg/L
29 2908271	Bathroom by Superintendents Closer to Stairs	Sink	0.004 mg/L
30 2908272	Bathroom Left of Middle School Entrance	Sink	0.140 mg/L
31 2908273	Superintendents Office	Sink	0.004 mg/L
32 2908274	Boys Bathroom by Assistant Superintendent	Sink #1 (Left to Right)	0.009 mg/L
33 2908275	Boys Bathroom by Assistant Superintendent	Sink #2	0.231 mg/L
34 2908276	Hallway by High School Guidance	Bubbler	0.007 mg/L
35 2908277	Girls Bathroom by High School Guidance	Sink #1 (Left to Right)	0.005 mg/L
36 2908278	Girls Bathroom by High School Guidance	Sink #2	0.008 mg/L

NDL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LAO00107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Middle School/High School

Date Collected: 04/13/2023

Collected By: Nicholas Coon

Date Received: 04/13/2023

Date Analyzed: 04/18/2023

Analyzed By: Ernest Sanchez

Signature: 

Analyte: Pb Water

Analytical Method: EPA 200.9

NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
37 2908279	Auditorium Bathroom Stage Left	Sink	0.032 mg/L
38 2908280	Auditorium Bathroom Stage Right	Sink	0.033 mg/L
39 2908281	Hallway by Band Room	Bubbler	0.086 mg/L
40 2908282	Band Office	Sink	0.078 mg/L
41 2908283	Room 152	Sink #1 (Left to Right)	0.023 mg/L
42 2908284	Room 152	Sink #2	0.011 mg/L
43 2908285	Room 152	Sink #3	0.002 mg/L
44 2908286	Room 152	Sink #4	BDL < 0.001 mg/L
45 2908287	Room 152	Sink #5	0.015 mg/L

DL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LA000107 Massachusetts DOH No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.
Water Sample Report

RE: Tuckahoe Middle School/High School


Date Collected: 04/13/2023
Collected By: Nicholas Coon
Date Received: 04/13/2023
Date Analyzed: 04/18/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
46 2908288	Room 152	Sink #6	BDL < 0.001 mg/L
47 2908289	Hallway by Gym Tall Water Fountain	Bubbler	0.076 mg/L
48 2908290	Hallway by Gym Short Water Fountain	Bubbler	0.074 mg/L
49 2908291	Hallway by 268	Bottle Filler	0.001 mg/L
50 2908292	Hallway by Room 268 Mens Bathroom	Sink #1 (Left to Right)	0.012 mg/L
51 2908293	Hallway by Room 268 Mens Bathroom	Sink #2 (Left to Right)	0.008 mg/L
52 2908294	Hallway by Room 268 Mens Bathroom	Sink #3	0.011 mg/L
53 2908295	Hallway by Room 268 Womens Bathroom	Sink #1 (Left to Right)	0.007 mg/L
54 2908296	Hallway by Room 268 Womens Bathroom	Sink #2	0.008 mg/L

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Middle School/High School

Date Collected: 04/13/2023
Collected By: Nicholas Coon
Date Received: 04/13/2023
Date Analyzed: 04/18/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
55 2908297	AV Room	Sink	0.023 mg/L
56 2908298	Girls Bathroom by Room 208	Sink #1 (Left to Right)	0.003 mg/L
7 2908299	Girls Bathroom by Room 208	Sink #2	0.004 mg/L
58 2908300	Girls Bathroom by Room 311	Sink #1 (Left to Right)	0.002 mg/L
59 2908301	Girls Bathroom by Room 311	Sink #2	0.004 mg/L
60 2908302	Hallway by Room 311/308	Bubbler	BDL < 0.001 mg/L
61 2908303	Hallway by Room 314	Bubbler	0.003 mg/L
62 2908304	Hallway by Room 302	Bubbler	0.002 mg/L
63 2908305	Boys Bathroom by Room 309	Sink #1 (Left to Right)	0.004 mg/L

BDL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LA000107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Middle School/High School


Date Collected: 04/13/2023
Collected By: Nicholas Coon
Date Received: 04/13/2023
Date Analyzed: 04/18/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
64 2908306	Boys Bathroom by Room 309	Sink #2	0.001 mg/L
65 2908307	Room 352	Island Sink #1 (Left to Right)	0.015 mg/L
66 2908308	Room 352	Sink #2	0.018 mg/L
67 2908309	Room 352	Sink #3	0.003 mg/L
68 2908310	Room 352	Sink #4	0.014 mg/L
69 2908311	Room 352	Sink #5	0.008 mg/L
70 2908312	Room 352	Sink #6	0.008 mg/L
71 2908313	Room 352	Sink #7	0.009 mg/L
72 2908314	Room 351	Sink #1 (Left to Right)	0.001 mg/L

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Middle School/High School


Date Collected: 04/13/2023
Collected By: Nicholas Coon
Date Received: 04/13/2023
Date Analyzed: 04/18/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
73 2908315	Room 351	Sink #2	0.001 mg/L
74 2908316	Room 351	Sink #3	0.010 mg/L
75 2908317	Room 351	Sink #4	0.005 mg/L
76 2908318	Room 351	Sink #5	0.004 mg/L
77 2908319	Room 351	Sink #6	0.035 mg/L
78 2908320	Room 351	Sink #7	0.001 mg/L
79 2908321	Boys by 205	Sink #1 (Left to Right)	0.008 mg/L
80 2908322	Hallway by 206	Bubbler	0.036 mg/L
81 2908323	Hallway by Room 210	Bubbler	0.016 mg/L

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Middle School/High School

Date Collected: 04/13/2023
Collected By: Nicholas Coon
Date Received: 04/13/2023
Date Analyzed: 04/18/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
82 2908324	Hallway by Room 202B	Bottle	BDL < 0.001 mg/L
83 2908325	Art Room	Next to Kiln Sink #1 (Left to Right)	1.048 mg/L
↓ 2908326	Art Room	Sink #2	0.012 mg/L
85 2908327	Art Room	Sink #3	0.003 mg/L
86 2908328	Room 250	Island Sink #1 (Left to Right)	0.021 mg/L
87 2908329	Room 250	Island Sink #2	0.001 mg/L
88 2908330	Room 250	Island Sink #3	0.002 mg/L
89 2908331	Room 250	Island Sink #4	0.002 mg/L
90 2908332	Room 250	Island Sink #5	0.027 mg/L

NDL = Below Detectable Limits


Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LA000107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Middle School/High School

Date Collected: 04/13/2023
Collected By: Nicholas Coon
Date Received: 04/13/2023
Date Analyzed: 04/18/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
91 2908333	Room 250	Sink #6 (Left to Right)	BDL < 0.001 mg/L
92 2908334	Room 250	Sink #7	0.005 mg/L
93 2908335	Room 251 Chemical Room	Sink	0.027 mg/L
94 2908336	Room 252	Island Sink #1 (Left to Right)	0.001 mg/L
95 2908337	Room 252	Island Sink #2	0.001 mg/L
96 2908338	Room 252	Island Sink #3	BDL < 0.001 mg/L
97 2908339	Room 252	Island Sink #4	BDL < 0.001 mg/L
98 2908340	Room 252	Island Sink #5	BDL < 0.001 mg/L
99 2908341	Room 252	Island Sink #6	BDL < 0.001 mg/L

DL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LA000107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.
Water Sample Report

RE: Tuckahoe Middle School/High School

Date Collected: 04/13/2023
Collected By: Nicholas Coon
Date Received: 04/13/2023
Date Analyzed: 04/18/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
100 2908342	Room 252	Island Sink #7	0.005 mg/L
101 2908343	Room 253	Sink #2 (Left to Right)	0.021 mg/L
102 2908344	Room 253	Sink #3	0.011 mg/L
103 2908345	Room 253	Sink #4	0.001 mg/L
104 2908346	Room 253	Sink #5	0.007 mg/L
105 2908347	Room 253	Sink #6	0.002 mg/L
106 2908348	Room 253	Sink #7	0.005 mg/L
107 2908349	Room 253	Sink #8	BDL < 0.001 mg/L
108 2908350	Outdoor By Field	Sipgot #1 (Left to Right)	0.058 mg/L

Eastern Analytical Services, Inc.
Water Sample Report

RE: Tuckahoe Middle School/High School

Date Collected: 04/13/2023
Collected By: Nicholas Coon
Date Received: 04/13/2023
Date Analyzed: 04/18/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
109 2908351	Outdoor By Field	Sipgot #2	0.001 mg/L
110 2908352	Outdoor By Field	Sipgot #3	0.001 mg/L
Blank 2908353	Not Applicable	Blank	BDL < 0.001 mg/L

Eastern Analytical Services, Inc.

4 Westchester Plaza - Elmsford, NY 10523

www.EASInc.com

914-592-8380

CHAIN OF CUSTODY

EAS Client: Regulatory Compliance
245 Albany Ave
Thornwood NY 10594

No. of Samples: 110 + 1 Blank

Analyte: **Asbestos** **Lead** **Fungi**
☐ PLM ☐ Solid ☐ Spore Trap
☐ NOB PLM Only ☐ Dust ☐ Tape Lift
☐ NOB TEM Only ☐ Air
☐ NOB PLM/TEM ☒ Water **Other**
☐ NOB TEM/PLM ☐ Other **Analyte**
☐ Air 7400 (PCM)
☐ Air AHERA (TEM)
☐ Air 7402 (TEM) **TCLP**
☐ Water (TEM) ☐ Pb Only
☐ Other ☐ 8 RCRA

Turn-Around ☐ 03Hr ☐ 06Hr ☐ 12Hr ☐ 24Hr ☐ 30Hr
☐ 48Hr ☐ 72Hr ☐ 96Hr ☐ 5Day ☒ Other 2 weeks (10 days)

Shipped Via: ☐ US Mail ☒ Walk In
☐ FedEx ☐ US Exp
☐ UPS ☐ Courier
☐ Drop Box ☐ Other

State of Origin: ☒ NY ☐ CT ☐ NJ ☐ PA ☐ MA
☐ RI ☐ ME ☐ VT ☐ Other

Sample Disposition ☒ (Std.) ☐ (Return)

Client Project Name/Number: Tuckahoe Middle School/High School

Sampled By: Nicholas Coon *Nicholas Coon* 4/13/23
Name (Print or Type) Signature Date

Submitted By: Nicholas Coon *Nicholas Coon* 4/13/23
Name (Print or Type) Signature Date

Comments: Run samples 20A + 20B as one sample

FOR LABORATORY USE ONLY

APR 13 '23 17:59

Account Number: _____
Received By: E. Sanchez *E. Sanchez* _____
Name (Print) Signature Date Time
Logged-In By: _____
Prepped By: _____
Analyzed By: _____
Re-Analyzed By: _____
Checked By: _____
Logged-Out By: _____

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 1 of 11

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

 Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☒ Other _____

Sample Number	Sample Location	Sample Description	Result
2908243	Kitchen	Sink #1 L-R	
2908244	Kitchen	" " #2	
2908245	Kitchen	" " #3	
2908246	Serving Side Cafeteria	Sink	
2908247	outside Kitchen	Sink Bottle Filler	
2908248	Home Careers Room	Sink	
2908249	Room 128 Office	Sink #1 L-R	
2908250	" "	" " #2	
2908251	Room 128 Bathroom	Sink	
2908252	Girls Locker Room	Sink #1 L-R	

APR 13 '23 17:59

Comments: _____

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 2 of 11

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

 Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☒ 5 Day ☐ Other _____

Sample Number	Sample Location	Sample Description	Result
2908253	Girls Locker Room	Sink # 2	
2908254	Girls Locker Room Office	Sink	
2908255	Bathroom across from 128	Sink	
2908256	Bathroom Across from Boiler Room	Sink	
2908257	Boys Locker Room	Sink # 1 L → R	
2908258	" " "	Sink # 2	
2908259	" " "	Sink # 3	
2908260	Boys Locker Room Office	Sink	
2908261	Custodial Office	Sink	
2908262	Custodial Office	Ice machine	

Comments: 20B APR 13'23 17:59

Turn Samples to A P 20B as one sample

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 3 of 11

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

 Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 06 Hr
☐ 12 Hr
☐ 24 Hr
☐ 30 Hr
☐ 48 Hr
☐ 72 Hr
☐ 96 Hr
☒ 5 Day

Sample Number	Sample Location	Sample Description	Result
2908263	21 Teachers Lounge	Sink	
2908264	22 Teachers Lounge Bathroom by Entrance	Sink	
2908265	23 Teachers Lounge Bathroom far side	Sink	
2908266	24 Hallway by Main office	Bubbler	
2908267	25 Nurses Bathroom	Sink	
2908268	26 Main office Bathroom #1 L->R	Sink	
2908269	27 " " #2	Sink	
2908270	28 Hallway by Business office	Bubbler	
2908271	29 Bathroom by Superintendent's closer to stairs	Sink	
2908272	30 Bathroom Left of MS Entrance	Sink	

Comments: _____
 APR 13 '23 17:59

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 4 of 11

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

 Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☒ Other _____

Sample Number	Sample Location	Sample Description	Result
2908273 <u>31</u>	<u>Super Intendents office</u>	<u>Sink</u>	
2908274 <u>32</u>	<u>Boys Bathroom by Assistant Super.</u>	<u>Sink #1 L-R</u>	
2908275 <u>33</u>	<u>" " " "</u>	<u>" " #2</u>	
2908276 <u>34</u>	<u>Hallway by HS Guidance</u>	<u>Bubbler</u>	
2908277 <u>35</u>	<u>Girls bathroom by High School Guidance</u>	<u>Sink #1 L-R</u>	
2908278 <u>36</u>	<u>" " " "</u>	<u>" " #2</u>	
2908279 <u>37</u>	<u>Auditorium Bathroom Stage Left</u>	<u>Sink</u>	
2908280 <u>38</u>	<u>" " Stage Right</u>	<u>Sink</u>	
2908281 <u>39</u>	<u>Hallway by Band Room</u>	<u>Bubbler</u>	
2908282 <u>40</u>	<u>Band office</u>	<u>Sink</u>	

Comments: _____

APR 13 '23 18:00

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 5 of 11

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☒ Other _____

Sample Number	Sample Location	Sample Description	Result
2908283	Room 152	Sink #1 L→R	
2908284	" "	" " #2	
2908285	" "	" " #3	
2908286	" "	" " #4	
2908287	" "	" " #5	
2908288	" "	" " #6	
2908289	Hallway by Gym Tall Water Fountain	Bubbler	
2908290	Hallway by Gym Short Water Fountain	Bubbler	
2908291	Hallway by 268	Bottle Filler	
2908292	Hallway by Room 268 Mens Bathroom	Sink #1 L→R	

Comments: _____

APR 13 '23 18:00

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 6 of 11

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

 Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☒ 5 Day ☐ Other _____

Sample Number	Sample Location	Sample Description	Result
2908293	Hallway by Room 268 Mens Bathroom	Sink #2 L-R	
2908294	" " " "	" " #3	
2908295	Hallway by Room 268 Womens Bathroom	Sink #1 L-R	
2908296	" " " "	" " #2	
2908297	AV Room	Sink	
2908298	Girls Bathroom by Room 208	Sink #1 L-R	
2908299	" " " "	" " #2	
2908300	Girls Bathroom by 311	Sink #1 L-R	
2908301	" " " "	" " #2	
2908302	Hallway by Room 311/308	Bubbler	

Comments: _____

APR 13 '23 18:00

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 7 of 11

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☒ Other _____

Sample Number	Sample Location	Sample Description	Result
2908303 <u>61</u>	<u>Hallway by Room 314</u>	<u>Bubbler</u>	
2908304 <u>62</u>	<u>Hallway by Room 302</u>	<u>Bubbler</u>	
2908305 <u>63</u>	<u>Boys Bathroom by Room 309</u>	<u>Sink #1 L→R</u>	
2908306 <u>64</u>	<u>" " "</u>	<u>" " #2</u>	
2908307 <u>65</u>	<u>Room 352</u>	<u>Island Sink #1 L→R</u>	
2908308 <u>66</u>	<u>" "</u>	<u>Sink #2</u>	
2908309 <u>67</u>	<u>" "</u>	<u>" " #3</u>	
2908310 <u>68</u>	<u>" "</u>	<u>" " #4</u>	
2908311 <u>69</u>	<u>" "</u>	<u>" " #5</u>	
2908312 <u>70</u>	<u>" "</u>	<u>" " #6</u>	

APR 13 '23 18:00

Comments: _____

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☒ Other _____

Sample Number	Sample Location	Sample Description	Result
2908313 <u>71</u>	<u>Room 352</u>	<u>Sink #7</u>	
2908314 <u>72</u>	<u>Room 351</u>	<u>Sink #1 L→R</u>	
2908315 <u>73</u>	<u>Room 351</u>	<u>1" " #2</u>	
2908316 <u>74</u>	<u>" "</u>	<u>#3</u>	
2908317 <u>75</u>	<u>" "</u>	<u>#4</u>	
2908318 <u>76</u>	<u>" "</u>	<u>#5</u>	
2908319 <u>77</u>	<u>" "</u>	<u>#6</u>	
2908320 <u>78</u>	<u>" "</u>	<u>#7</u>	
2908321 <u>79</u>	<u>Boys by 205</u>	<u>Sink #1 L→R</u>	
2908322 <u>80</u>	<u>Hallway by 206</u>	<u>Sink #1 <u>Bubbler</u></u>	

Comments: _____

APR 13 '23 18:00

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 9 of 11

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☒ Other _____

Sample Number	Sample Location	Sample Description	Result
2908323	81 Hallway by Room 210	Bubbler	
2908324	82 Hallway by Room 203	Bottle	
2908325	83 Art Room	Next to Kiln Sink #1 L→R	
2908326	84 " "	Sink #2	
2908327	85 " "	Sink #3	
2908328	86 Room 250	Island Sink #1 L→R	
2908329	87 " "	" " #2	
2908330	88 " "	" " #3	
2908331	89 " "	" " #4	
2908332	90 " "	" " #5	

APR 13 '23 18:00

Comments: _____

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 10 of 11

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☒ 5 Day ☐ Other _____

Sample Number	Sample Location	Sample Description	Result
2908333	Room 250	Sink # 6 L→R	
2908334	" "	" "#7	
2908335	Room 251 Chemical Room	Sink	
2908336	Room 252	Island Sink #1 L→R	
2908337	" "	#2	
2908338	" "	#3	
2908339	" "	#4	
2908340	" "	#5	
2908341	" "	#6	
2908342	" "	#7	

Comments: _____ APR 13 '23 18:00

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 11 of 11

Date Collected: 4/13/23
 Collected By: N. Coon
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: Regulatory Compliance
 Address: _____

 Client Project Number/Name
 RE: Tuckahoe Middle School/High School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☒ 5 Day ☐ Other _____

Sample Number	Sample Location	Sample Description	Result
2908343 <u>101</u>	<u>Room 253</u>	<u>Sink #2 L→R</u>	
2908344 <u>102</u>	<u>"</u>	<u>#3</u>	
2908345 <u>103</u>	<u>"</u>	<u>#4</u>	
2908346 <u>104</u>	<u>"</u>	<u>#5</u>	
2908347 <u>105</u>	<u>"</u>	<u>#6</u>	
2908348 <u>106</u>	<u>"</u>	<u>#7</u>	
2908349 <u>107</u>	<u>"</u>	<u>#8</u>	
2908350 <u>108</u>	<u>out door by Feild</u>	<u>Sig got #1 L→R</u>	
2908351 <u>109</u>	<u>"</u>	<u>#2</u>	
2908352 <u>110</u>	<u>"</u>	<u>#3</u>	

Comments: _____

APR 13 '23 18:00

2908353 Blank

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Schools - Cottle Elementary

Date Collected: 04/12/2023

Collected By: Nicholas Coon

Date Received: 04/12/2023

Date Analyzed: 04/14/2023

Analyzed By: Ernest Sanchez

Signature: 

Analyte: Pb Water

Analytical Method: EPA 200.9

NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
1 2907785	Kitchen	Sink #1 (Left to Right)	0.001 mg/L
2 2907786	Kitchen	Sink #2	0.001 mg/L
 2907787	Kitchen	Sink #3	0.006 mg/L
4 2907788	Cafeteria	Bottle Filler	BDL < 0.001 mg/L
5 2907789	Library Back Room	Sink	0.019 mg/L
6 2907790	Room 24	Sink	0.004 mg/L
7 2907791	Room 24	Bubbler	0.031 mg/L
8 2907792	Room 26	Sink	0.307 mg/L
9 2907793	Room 27	Sink	0.008 mg/L

BDL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LAO00107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.
Water Sample Report

RE: Tuckahoe Schools - Cottle Elementary

Date Collected: 04/12/2023
Collected By: Nicholas Coon
Date Received: 04/12/2023
Date Analyzed: 04/14/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
10 2907794	Room 28	Sink	0.024 mg/L
11 2907795	Room 29	Sink	0.252 mg/L
2 2907796	Room 29	Bubbler	0.001 mg/L
13 2907797	Room 30	Sink	0.005 mg/L
14 2907798	Room 30	Bubbler	0.013 mg/L
15 2907799	Room 31	Sink	0.003 mg/L
16 2907800	Room 32	Sink	0.001 mg/L
17 2907801	Room 32	Bubbler	BDL < 0.001 mg/L
18 2907802	Room 33 Office	Sink	0.011 mg/L

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Schools - Cottle Elementary

Date Collected: 04/12/2023
Collected By: Nicholas Coon
Date Received: 04/12/2023
Date Analyzed: 04/14/2023
Analyzed By: Ernest Sanchez

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Signature: 

Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
19 2907803	Room 33	Sink	0.008 mg/L
20 2907804	Room 35	Sink	0.075 mg/L
21 2907805	Room 35	Bubbler	0.006 mg/L
22 2907806	Adult Toilet by Room 36	Sink	0.004 mg/L
23 2907807	Room 37	Sink #1 (Left to Right)	0.002 mg/L
24 2907808	Room 37	Sink #2	0.008 mg/L
25 2907809	Room 37	Sink #3	0.003 mg/L
26 2907810	Room 37	Sink #4	0.005 mg/L
27 2907811	Room 37	Sink #5	0.008 mg/L

NDL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LAO00107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Schools - Cottle Elementary


Date Collected: 04/12/2023

Collected By: Nicholas Coon

Date Received: 04/12/2023

Date Analyzed: 04/14/2023

Analyzed By: Ernest Sanchez

Signature: 

Analyte: Pb Water

Analytical Method: EPA 200.9

NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
28 2907812	Locker Room #2	Sink	0.055 mg/L
29 2907813	1st Floor New Wing Girls Bathroom	Sink #1 (Left to Right)	0.007 mg/L
J 2907814	1st Floor New Wing Girls Bathroom	Sink #2	0.004 mg/L
31 2907815	Hallway by Room 38	Bottle Filler	BDL < 0.001 mg/L
32 2907816	Boys Bathroom by Room 38	Sink #1 (Left to Right)	BDL < 0.001 mg/L
33 2907817	Boys Bathroom by Room 38	Sink #2	BDL < 0.001 mg/L
34 2907818	Room 38	Sink	0.004 mg/L
35 2907819	Room 39	Sink	0.006 mg/L
36 2907820	Room 39	Bubbler	0.003 mg/L

BDL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LA000107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Schools - Cottle Elementary

Date Collected: 04/12/2023
Collected By: Nicholas Coon
Date Received: 04/12/2023
Date Analyzed: 04/14/2023
Analyzed By: Ernest Sanchez

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Signature: 

Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
37 2907821	Room 41	Sink	0.001 mg/L
38 2907822	Room 41	Bubbler	0.018 mg/L
39 2907823	Room 40	Sink	0.003 mg/L
40 2907824	Room 40	Bubbler	0.008 mg/L
41 2907825	Room 43	Sink	0.010 mg/L
42 2907826	Room 41	Sink	0.033 mg/L
43 2907827	Room 41	Bubbler	0.006 mg/L
44 2907828	Room 45	Sink	0.005 mg/L
45 2907829	Room 45	Bubbler	0.026 mg/L

NDL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LA000107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Schools - Cottle Elementary

Date Collected: 04/12/2023
Collected By: Nicholas Coon
Date Received: 04/12/2023
Date Analyzed: 04/14/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
46 2907830	Room 44	Sink	0.001 mg/L
47 2907831	Room 44	Bubbler	0.002 mg/L
3 2907832	2nd Floor Hallway by Elevator	Bottle Filler	BDL < 0.001 mg/L
49 2907833	All Gender/Staff Bathroom 2nd Floor	Sink	BDL < 0.001 mg/L
50 2907834	STEM Classroom	Sink	0.008 mg/L
51 2907835	Room 20	Sink	0.001 mg/L
52 2907836	All Gender Bathroom by Room 20	Sink	0.008 mg/L
53 2907837	Boys Room by Assistant Principal	Sink #1 (Left to Right)	0.001 mg/L
54 2907838	Boys Room by Assistant Principal	Sink #2	0.001 mg/L

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Schools - Cottle Elementary


Date Collected: 04/12/2023
Collected By: Nicholas Coon
Date Received: 04/12/2023
Date Analyzed: 04/14/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
55 2907839	Boys Room by Assistant Principal	Sink #3	0.001 mg/L
56 2907840	Girls Bathroom by Room 19	Sink #1 (Left to Right)	0.003 mg/L
57 2907841	Girls Bathroom by Room 19	Sink #2	0.002 mg/L
58 2907842	Girls Bathroom by Room 19	Sink #3	0.001 mg/L
59 2907843	Girls Bathroom by Room 19	Sink #4	0.002 mg/L
60 2907844	Nurses Room 19	Sink	0.002 mg/L
61 2907845	Room 17	Sink	0.002 mg/L
62 2907846	Room 17	Bubbler	0.014 mg/L
63 2907847	Main Office Bathroom	Sink	0.967 mg/L

Eastern Analytical Services, Inc.
Water Sample Report

RE: Tuckahoe Schools - Cottle Elementary

Date Collected: 04/12/2023
Collected By: Nicholas Coon
Date Received: 04/12/2023
Date Analyzed: 04/14/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
64 2907848	Room 16	Sink	0.018 mg/L
65 2907849	Room 16	Bubbler	0.006 mg/L
66 2907850	Room 15	Sink	0.142 mg/L
67 2907851	Room 14	Sink	0.942 mg/L
68 2907852	Room 14	Bubbler	0.088 mg/L
69 2907853	Room 13	Sink	0.040 mg/L
70 2907854	Room 12	Sink	0.010 mg/L
71 2907855	Room 12	Bubbler	0.002 mg/L
72 2907856	Hallway by Room 10	Bottle	0.001 mg/L

Eastern Analytical Services, Inc.**Water Sample Report**

RE: Tuckahoe Schools - Cottle Elementary

Date Collected: 04/12/2023

Collected By: Nicholas Coon

Date Received: 04/12/2023

Date Analyzed: 04/14/2023

Analyzed By: Ernest Sanchez

Signature: 

Analyte: Pb Water

Analytical Method: EPA 200.9

NYS Lab Number: 10851

Client: RegCom

245 Albany Avenue

Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
73 2907857	Hallway by Room 10	Bubbler	0.001 mg/L
74 2907858	All Genders by Room 11	Sink	0.002 mg/L
75 2907859	Faculty Bathroom by Room 11	Sink	0.009 mg/L
76 2907860	Room 6	Sink	0.025 mg/L
77 2907861	Room 6	Bubbler	0.001 mg/L
78 2907862	Room 5	Sink	0.004 mg/L
79 2907863	Room 5	Bubbler	BDL < 0.001 mg/L
80 2907864	Bathroom by Head Custodian Office	Sink	0.009 mg/L
81 2907865	Room 4	Sink	0.002 mg/L

BDL = Below Detectable Limits

Liability Limited to Cost of Analysis

Results Applicable to Those Items Tested

Rhode Island DOH No. LA000107 Massachusetts DOL No. A A 000072 Connecticut DOH No. PH-0622 Maine DEP No. LA-024 Vermont DOH No. AL-709936

Eastern Analytical Services, Inc.
Water Sample Report

RE: Tuckahoe Schools - Cottle Elementary

Date Collected: 04/12/2023
Collected By: Nicholas Coon
Date Received: 04/12/2023
Date Analyzed: 04/14/2023
Analyzed By: Ernest Sanchez
Signature: 
Analyte: Pb Water
Analytical Method: EPA 200.9
NYS Lab Number: 10851

Client: RegCom
245 Albany Avenue
Thornwood, NY 10594

Sample ID# / Lab ID#	Sample Location	Sample Notes	Concentration
82 2907866	Room 3	Sink	0.028 mg/L
83 2907867	Room 3	Bubbler	0.001 mg/L
84 2907868	Room 2A	Sink	0.001 mg/L
85 2907869	Room 2A	Bubbler	BDL < 0.001 mg/L
86 2907870	Room 1	Sink	BDL < 0.001 mg/L
87 2907871	Room 1	Bubbler	0.024 mg/L
Blank 2907872	Not Applicable	Blank	BDL < 0.001 mg/L

Eastern Analytical Services, Inc.

4 Westchester Plaza - Elmsford, NY 10523

www.EASInc.com

914-592-8380

CHAIN OF CUSTODY

EAS Client: Reg Com
245 Albany Ave
Thamvoot NY 10594

No. of Samples: 87 + 1 Blank

Analyte: **Asbestos** **Lead** **Fungi**
☐ PLM ☐ Solid ☐ Spore Trap
☐ NOB PLM Only ☐ Dust ☐ Tape Lift
☐ NOB TEM Only ☐ Air
☐ NOB PLM/TEM ☒ Water **Other**
☐ NOB TEM/PLM ☐ Other **Analyte**
☐ Air 7400 (PCM)
☐ Air AHERA (TEM)
☐ Air 7402 (TEM) **TCLP**
☐ Water (TEM) ☐ Pb Only
☐ Other ☐ 8 RCRA

Turn-Around ☐ 03Hr ☐ 06Hr ☐ 12Hr ☐ 24Hr ☐ 30Hr
☐ 48Hr ☐ 72Hr ☐ 96Hr ☐ 5Day ☐ Other

Shipped ☐ US Mail ☒ Walk In
 Via: ☐ FedEx ☐ US Exp
☐ UPS ☐ Courier
☐ Drop Box ☐ Other

State of ☒ NY ☐ CT ☐ NJ ☐ PA ☐ MA
 Origin: ☐ RI ☐ ME ☐ VT ☐ Other

Sample Disposition ☒ (Std.) ☐ (Return)

Client Project Name/Number: Tuckahoe Schools Cottle Elementary

Sampled By: Nicholas Coon Nicholas Coon 4/12/23
Name (Print or Type) Signature Date

Submitted By: Nicholas Coon Nicholas Coon 4/12/23
Name (Print or Type) Signature Date

Comments: _____

FOR LABORATORY USE ONLY

Account Number: _____

Received By: UNBarnier Meghan Warner APR 12 '23 16:40
Name (Print) Signature Date Time

Logged-In By: _____

Prepped By: _____

Analyzed By: _____

Re-Analyzed By: _____

Checked By: _____

Logged-Out By: _____

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 1 of 9

4/12/23

Date Collected:

Collected By: N. Cam

Date Received:

Date Analyzed:

Analyzed By:

Time:

Signature:

EAS Client:

Address:

RegCom

Client Project Number/Name

Coffee Shop

RE:

Turn- ☐ 03 Hr

Around ☐ 12 Hr

☐ 30 Hr

☐ 72 Hr

☐ 5 Day

☐ 06 Hr

☐ 24 Hr

☐ 48 Hr

☐ 96 Hr

☐ Other

Sample Number	Sample Location	Sample Description	Result
2907785	1 Kitchen	Sink #1 LOR	
2907786	2 "	#2	
2907787	3 "	#3	
2907788	4 Cafeteria	Bottle Filler	
2907789	5 Library Back Room	Sink	
2907790	6 Room 24	Sink Filler	
2907791	7 " "	Bubbler	
2907792	8 Room 26	Sink	
2907793	9 Room 27	Sink	
2907794	10 Room 28	Sink	

Comments:

APR 12 '23 16:40

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 2 of 9

4/11/23

Date Collected: _____
 Collected By: N. Can
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client:
 Address:

Client Project Number/Name
Coffee Shop

RE:

Turn-
 Around
☐ 03 Hr
☐ 12 Hr
☐ 30 Hr
☐ 72 Hr
☐ 5 Day
☐ 06 Hr
☐ 24 Hr
☐ 48 Hr
☒ 96 Hr
☐ Other

Sample Number	Sample Location	Sample Description	Result
2907795 11	Room 29	Sink	
2907796 12	" "	Bubbler	
2907797 13	Room 30	Sink	
2907798 14	" "	Bubbler	
2907799 15	Room 31	Sink	
2907800 16	Room 32	Sink	
2907801 17	" "	Bubbler	
2907802 18	Room 33 office	Sink	
2907803 19	Room 33	Sink	
2907804 20	Room 35	Sink	

Comments:

UJA / APR 12 '23 16:40

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 3 of 9

Date Collected: 4/12/23
 Collected By: P. Caw
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client:
 Address:

Client Project Number/Name
Coffee School

RE: _____

Turn- ☐ 03 Hr ☐ 06 Hr
 Around ☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☒ Other _____

Sample Number	Sample Location	Sample Description	Result
2907805 <u>21</u>	<u>Room 35</u>	<u>Bubbler</u>	
2907806 <u>22</u>	<u>Adult toilet by Room 36</u>	<u>Sink</u>	
2907807 <u>23</u>	<u>Room 37</u>	<u>Sink #1 L-R</u>	
2907808 <u>24</u>	<u>"</u>	<u>" " #2</u>	
2907809 <u>25</u>	<u>"</u>	<u>" " #3</u>	
2907810 <u>26</u>	<u>"</u>	<u>" " #4</u>	
2907811 <u>27</u>	<u>"</u>	<u>" " #5</u>	
2907812 <u>28</u>	<u>Locker Room #2</u>	<u>Sink</u>	
2907813 <u>29</u>	<u>1st Floor New Wing Girls Bathroom</u>	<u>Sink #1 L-R</u>	
2907814 <u>30</u>	<u>" " " "</u>	<u>" " #2</u>	

Comments: _____

APR 12 '23 16:40

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 4 of 9

4/12/23

Date Collected: _____
 Collected By: N. COON
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: _____
 Address: _____

Client Project Number/Name

RE: cattle

Turn-Around
☐ 03 Hr
☐ 12 Hr
☐ 30 Hr
☐ 72 Hr
☐ 5 Day
☐ 06 Hr
☐ 24 Hr
☐ 48 Hr
☐ 96 Hr
☒ Other

Sample Number	Sample Location	Sample Description	Result
2907815 31	Hallway By Room 38	Bottle Filler	
2907816 32	Boys Bathroom By Room 38	Sink #1 L→R	
2907817 33	1" " "	1" " #2	
2907818 34	Room 38	Sink	
2907819 35	Room 39	Sink	
2907820 36	1" " "	Bubbler	
2907821 37	Room 41	Sink	
2907822 38	" "	Bubbler	
2907823 39	Room 40	Sink	
2907824 40	" "	Bubbler	

Comments: _____

APR 12 '23 16:40

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 5 of 9

Date Collected: 4/12/23 EAS Client: N. ceon
 Collected By: N. ceon Address: _____
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☒ Other _____

Client Project Number/Name

RE: COFFEE

Sample Number	Sample Location	Sample Description	Result
2907825 41	Room 43	Sink	
2907826 42	Room 41	Sink	
2907827 43	" "	Bubbler	
2907828 44	Room 45	Sink	
2907829 45	" "	Bubbler	
2907830 46	Room 44	Sink	
2907831 47	" "	Bubbler	
2907832 48	2nd Floor Hallway by Elevator	Battle Filler	
2907833 49	All Center / Staff Bathroom by 2nd Floor	Sink	
2907834 50	STEM Classroom	Sink	

Comments: _____

NHIV APR 12 '23 10440 DATA.FRM 04/16/2014

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 6 of 9

Date Collected: _____
 Collected By: _____
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: _____
 Address: _____

Client Project Number/Name _____

RE: _____

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☐ Other _____

Sample Number	Sample Location	Sample Description	Result
2907835	Room 20	Sink	
2907836	All Gender Bathroom by Room 20	Sink	
2907837	Boys Room by Assistant Principal	Sink #1 L-7R	
2907838	" " "	" " #2	
2907839	" " "	" " #3	
2907840	Girls Bathroom by Room 19	Sink #1 L-7R	
2907841	" " "	" " #2	
2907842	" " "	" " #3	
2907843	" " "	" " #4	
2907844	Nurses Room 19	Sink	

Comments: _____

UN APR 12 '23 16:40

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 7 of 9

4/12/23

Date Collected: _____
 Collected By: N. Coen
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client:
 Address: _____

RE: Coffee Shop

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☒ 96 Hr
☐ 5 Day ☐ Other _____

Sample Number	Sample Location	Sample Description	Result
2907845 <u>61</u>	<u>Room 17</u>	<u>Sink</u>	
2907846 <u>62</u>	<u>" "</u>	<u>Bubbler</u>	
2907847 <u>63</u>	<u>Main Office Bathroom</u>	<u>Sink</u>	
2907848 <u>64</u>	<u>Room 16</u>	<u>Sink</u>	
2907849 <u>65</u>	<u>" "</u>	<u>Bubbler</u>	
2907850 <u>66</u>	<u>Room 15</u>	<u>Sink</u>	
2907851 <u>67</u>	<u>Room 14</u>	<u>Sink</u>	
2907852 <u>68</u>	<u>Room 14</u>	<u>Bubbler</u>	
2907853 <u>69</u>	<u>Room 13</u>	<u>Sink</u>	
2907854 <u>70</u>	<u>Room 12</u>	<u>Sink</u>	

Comments: _____

WV APR 12 '23 16:40

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 8 of 9

4/12/23

Date Collected: _____
 Collected By: N. Can
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client: _____
 Address: _____

Client Project Number/Name
 RE: Co Hile School

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☐ Other _____

Sample Number	Sample Location	Sample Description	Result
2907855	Room 12	Bubbler	
2907856	Hallway by Room 10	Bottle	
2907857	" " "	Bubbler	
2907858	All Gardens by Room 11	Sink	
2907859	Faculty Bathroom by Room 11	Sink	
2907860	Room 6	Sink	
2907861	" " "	Bubbler	
2907862	Room 5	Sink	
2907863	Room 5	Bubbler	
2907864	Bathroom by Head Custodian Office	Sink	

Comments: _____

WAV APR 12 '23 16:40

EASTERN ANALYTICAL SERVICES, INC.

BULK SAMPLE DATA SHEET

Page 9 of 9

Date Collected: 4/12/23
 Collected By: N. COON
 Date Received: _____
 Date Analyzed: _____
 Analyzed By: _____
 Time: _____
 Signature: _____

EAS Client:
 Address:

Turn-Around
☐ 03 Hr ☐ 06 Hr
☐ 12 Hr ☐ 24 Hr
☐ 30 Hr ☐ 48 Hr
☐ 72 Hr ☐ 96 Hr
☐ 5 Day ☒ Other _____

Client Project Number/Name
Co Hle School

RE: _____

Sample Number	Sample Location	Sample Description	Result
2907865 <u>81</u>	<u>Room 4</u>	<u>Sink</u>	
2907866 <u>82</u>	<u>Room 3</u>	<u>Sink</u>	
2907867 <u>83</u>	<u>" "</u>	<u>Bubbler</u>	
2907868 <u>84</u>	<u>Room 2A</u>	<u>Sink</u>	
2907869 <u>85</u>	<u>" "</u>	<u>Bubbler</u>	
2907870 <u>86</u>	<u>Room 1</u>	<u>Sink</u>	
2907871 <u>87</u>	<u>" "</u>	<u>Bubbler</u>	
2907872	<u>BLANK</u>		

Comments: _____

10/11 APR 12 '23 16:40